


Interior – First Floor

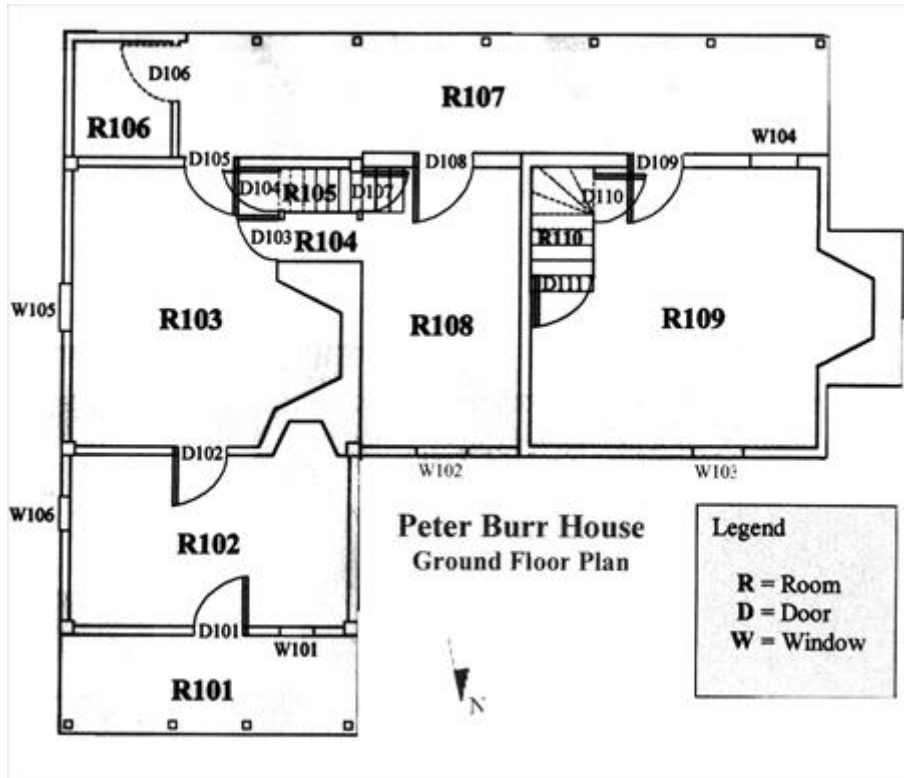

R110 - Closet under stairs

Inventory Condition and Assessment Program

Interior

Elevation:

Room #: R110


Room Name / Use: Closet


Date of Assessment: 3/12/99

Photo No.:

[42. Closet hall under stairs, R 111.](#)

Peter Burr House

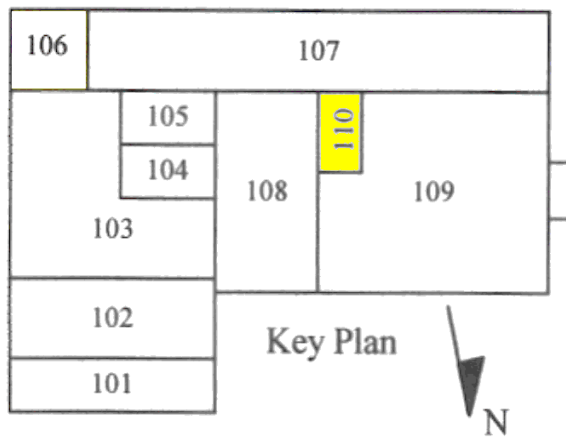

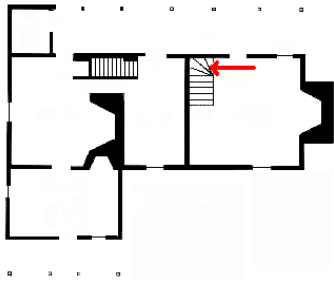

Closet under stairs, R110.



Feature Description	Condition
Flooring	
Northeast white pine tongue and grooved surface nailed flooring, random width was the original flooring of the stair closet.	No flooring except for two broken pieces remains in situ.
Walls	
The east and south walls were the he log and daubed walls of the log crib. Whitewash still heavily coats the walls.	While some daubing is missing, the log walls appear to be in salvageable condition.
The north wall consisted of the whitewashed treads and risers. The west wall was made of vertical boards, tongue, grooved and 1/4" beaded to show into the kitchen. The boards facing the closet were hand-planned and whitewashed.	The risers and treads as well as the w wall appear to be in good condition.
Ceiling	
The ceiling of the stair storage area was the back sides of the risers and the bottoms of the treads. All were originally whitewashed.	
Trim	
There was a plain board narrow trim nailed to the vertical board wall around the door opening to act as a doorstop.	All
Original Configuration	
The closet retains its original configuration.	.
Alterations	
There were no alterations.	